



TECHNICAL SUPPORT MANUAL BINDERS

The Lowrey Service Parts Department has a limited quantity of TSM Binders, part number 493-023091-001.

This is a one-inch, three-ring binder with durable vinyl cover and is being offered for \$1.00 while quantities last.

L25 INTERMITTENT OPERATION OF MICROPROCESSOR SYSTEM

Should you experience random failure of the microprocessor system which can be temporarily corrected by depressing the reset switch, make the following change.

Locate IC13 on Board 3 and remove the 15P capacitor from Pin 3.

L25 POWER SUPPLY*

The 1 amp Slo-Blo power supply fuse has been changed to a .75 amp Slo-Blo, part number 939-031304-001.

PHOTOCELL LAMP

It has been brought to our attention that some GE1819 photocell lamps, part number 939-003190-000, may have faulty internal connections resulting in intermittent volume loss.

D575 INTERMITTENT OPERATION OF SLAVE MICROPROCESSOR SYSTEM

If the Scanning System fails, resulting in various or all pushbutton lamps lighting, locate IC1 on Board 1 and remove the 15P capacitor from Pin 3.

NEWSLETTER CORRECTION

In the September/October 1981 Newsletter (D600 Intermittent Operation of Microprocessor System), we referred to Dwg. 12, Page 55. This should have read Dwg. 15, Page 44.

QUESTION OF THE MONTH

For what purposes do we provide the Toll-free Technical Hotline?

The Technical Hotline program is to be used for immediate technical problems and warranty verification only.

* Designates a change made in production and should be noted in your Service Manual along with the date of this Newsletter.