

Service & Parts Dept.



The Lowrey Company • 7373 N. Cicero Ave. • Lincolnwood • Chicago, Ill. 60646

For Model(s): H-25

Schematic Ref: NONE

Date: May 27-1966

Subject: DEAD KEY IN LOWER MANUAL

SYMPTOM

Dead key in the lower manual with sustain tabs off, but when sustain tabs are turned on, it will gradually return to normal.

CAUSE

Corresponding keying diode in upper manual shorted, causing -15 volts (control sustain voltage) to appear on lower manual keying diode.

CURE

Replace shorted diode.

EGW:lil

Edward G. Willcox-National Service Manager

#15

TECHNICAL BULLETIN