

Service & Parts Dept.



The Lowrey Company • 7373 N. Cicero Ave. • Lincolnwood • Chicago, Ill. 60646

For Model(s): TLO - TLS/TLO-R - H - H-R

Schematic Ref: AS ABOVE

Date: May 27-1966

Subject: "BLIP IN PEDAL DIVIDERS"

SYMPTOM

With a pedal pressed down, and playing any upper manual key, an occasional " blip " may occur in the pedal dividers.

CAUSE

Interference pulse applied to pedal dividers through negative supply.

CURE

Remove diode D-10. Refer to pedal switch schematic.

EGW:lil

Edward G. Willcox-National Service Manager

#14